


Serial Bar Code Scanner Installation Instructions

Contents

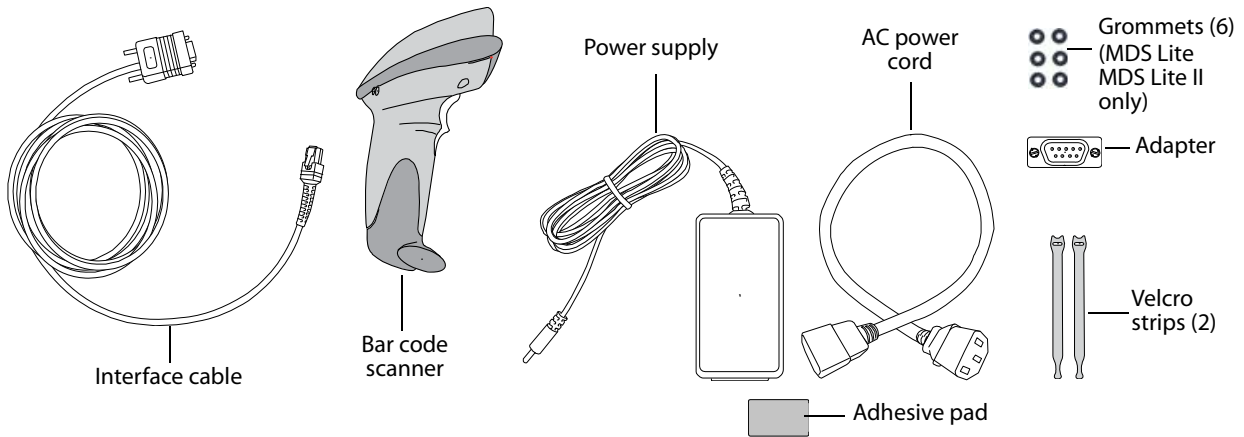

Follow these instructions to install the serial bar code scanner on the following SonoSite accessory: Mobile Docking System-M Series (MDSm), Mobile Docking System enhanced (MDS_e), Mobile Docking System Lite (MDS Lite), or Mobile Docking System Lite II (MDS Lite II).

See *Bar Code Scanner User Guide* for information on safety, cleaning, and disinfecting.

Attach interface cable

Connect the interface cable to the scanner as instructed in the *DS6707 Quick Start Guide* provided.

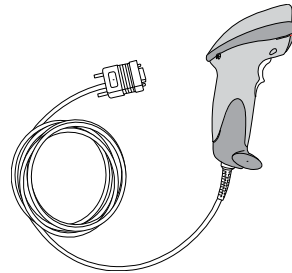


Figure 1 Attach Interface Cable

Connect adapter and cable to mini-dock

- 1 Connect the adapter (**U**) to the RS-232 port **IOIOI** on the mini-dock.
The nuts on the adapter face away from the mini-dock.
- 2 Connect the interface cable (**V**) to the adapter, securing the connector by turning its thumb screws.

Connect power supply (MDSe or MDSm)

- 1 Remove the back panel.
- 2 Connect the AC power cord (**I**) to the power supply (**W**) and to the power strip inside the MDSe/MDSm.
- 3 Remove the backing from one side of the adhesive pad, and affix the pad to the power supply, on the side without the label.
- 4 Remove the other backing from the adhesive pad, and affix the power supply to the shelf at an angle, taking care not to cover the warning labels. See [Figure 2](#).
Positioning the power supply at an angle allows you to unplug the AC power cord later, if necessary.
- 5 With the power supply cable extending out the upper right-hand notch, slide the back panel up and in.

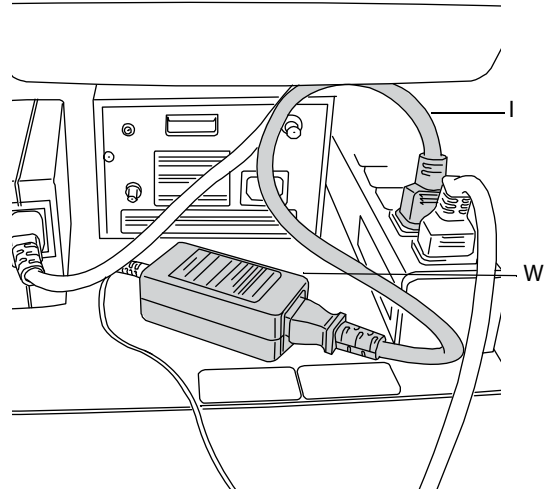


Figure 2 Affix Power Supply at an Angle

Connect power supply (MDS Lite or MDS Lite II)

- 1 Make sure that the shelf is no more than 11" from the base. Lower or raise it as necessary. See [Figure 3](#).
- 1 Connect the AC power cord (**I**) to the power supply (**W**) and to the power strip on the column.
- 2 Remove the backing from one side of the adhesive pad, and affix the pad to the power supply, on the side without the label.
- 3 Remove the other backing from the adhesive pad, and then affix the power supply to the rear of the shelf. See [Figure 4](#).

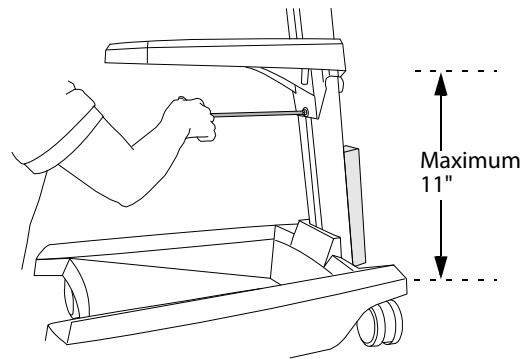


Figure 3 Lower or Raise Shelf If Necessary

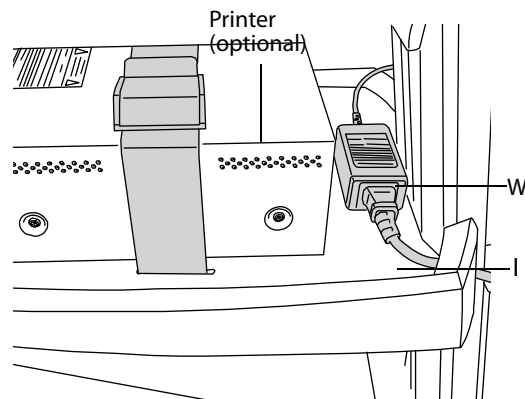


Figure 4 Affix Power Supply to Rear of Shelf

Insert grommets

- 1 If grommets are in the side of the column, temporarily remove them.
- 2 Insert the power supply cable into the side of the column, from the shelf up to the platform.
- 3 Insert grommets to secure the power supply cable in the column.

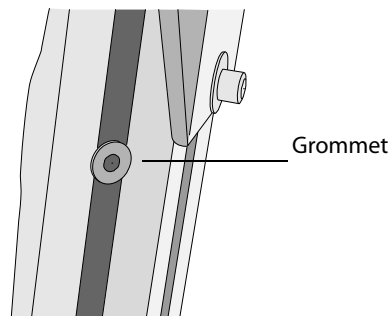


Figure 5 Install Grommets

Connect power supply to scanner

- 1 Connect the power supply cable (**W**) to the back of the interface cable connector. See Figure 6.
- 2 Secure the excess cable using the velcro strips.














Figure 6 Connect Power Supply

Set up system and program scanner

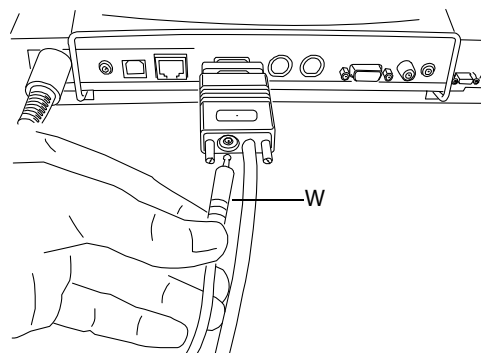- 1 Press the **SETUP** key on the ultrasound system.
- 2 Select **Connectivity**.
- 3 In the **Serial Port** list, select **Bar Code Scanner**.
- 4 Click **Yes** to restart the system.
Restarting activates Bar Code Scanner connectivity.
- 5 Using the bar code scanner, scan the Carriage Return/Line Feed bar code.
A copy of the Carriage Return/Line Feed bar code is in *DS6707 Quick Start Guide*.
- 6 Scan additional programming bar codes as desired.
You can program the scanner with various user preferences, such as beeper volume. Refer to *DS6707 Quick Start Guide*. For more comprehensive information, refer to *DS6707 Digital Imager Scanner Product Reference Guide*, available on the Motorola Web site at www.symbol.com/manuals.

Note: Because the bar code scanner, DVD recorder, and VCR require the same port on the mini-dock, you can connect only one of these peripherals at a time.

Table 1: Cables and Connectors

| Letter | Name | Illustration | Connector 1 [[Illustration] [Connects to] | Connector 2 [[Illustration] [Connects to] |
|--------|-------------------------------------|---|---|--|
| I | AC power cord 18 in./45.7 cm |  |  Bar code scanner power supply |  Power strip |
| U | Bar code scanner adapter |  | Bar code scanner interface cable | Mini-dock |
| V | Bar code scanner interface cable |  |  Bar code scanner |  Bar code scanner adapter and bar code scanner power supply |
| W | Bar code scanner power supply |  |  Bar code scanner interface cable |  AC power cord |

SonoSite and the SonoSite logo are either trademarks or registered trademarks of SonoSite, Inc.

The SonoSite product(s) referenced in this document may be covered by one or more of the following US patents: 5722412, 5817024, 5893363, 6135961, 6203498, 6364839, 6371918, 6383139, 6416475, 6447451, 6471651, 6569101, 6648826, 6575908, 6604630, 6817982, 6835177, 6962566, 7169108, D456509, D461895, D509900, D538432, D544962, D558351, D559390, and by the following counterpart foreign patents: AU727381, AU730822, CA2373065, CN98106133.8, CN98108973.9, DE60021552.0, DE60029777.2, DE60034670.6, DE69730563.5, DE6980539.6, DE69831698.3, FR0875203, FR0881492, FR0815793, FR1180970, FR1175713, GB0875203, GB0881492, GB0815793, GB1180970, GB1180971, GB1175713, IT0881492, IT0815793, IT1175713, KR532359, KR528102, NZ542968, RCD000897368-0001, SP0881492, SP0815793. Patents pending

Caution: Federal (United States) law restricts this device to sale by or on the order of a physician.

SonoSite, Inc.
21919 30th Drive SE
Bothell, WA 98021 USA
T: 1-888-482-9449 or
1-425-951-1200
F: 1-425-951-1201

SonoSite Ltd
Alexander House
40A Wilbury Way
Hitchin, Herts
SG4 OAP UK
T: +44-1462-444800
F: +44-1462-444801

11/2008
Copyright 2008 by
SonoSite, Inc.
All rights reserved.



P07572-03

